


Model number	Product Picture	Test date/time		Appearance	Function				Result	Remark
		Date	Time		Button	Volume/Sound	Pairing	Code		
308P		2019.8.24	100H	Pass	Pass	Fail for Bad sound	/	Pass	Fail	Function checked ok, but with bad sound, Speaker membrane is thin, it deformed after long time high temperature and high humidity environment. And also found some small rust spots on
		2019.8.29	200H	Pass	Pass	Fail for Bad sound		Pass	Fail	
		2019.9.2	300H	Pass	Pass	Fail for Bad sound		Pass	Fail	
		2019.9.7	400H	Pass	Pass	Fail for Bad sound		Pass	Fail	
		2019.9.12	500H	Pass	Pass	Fail for Bad sound		Pass	Fail	
309P		2019.8.24	100H	Fail	Pass	Fail for Bad sound	/	Pass	Fail	Function checked ok, but with bad sound, Speaker membrane is thin, it deformed after long time high temperature and high humidity environment. And also found some small rust spots on metal part. this Receiver housing injected by ABS757, this material nature can not resist long time high temperature environment.
		2019.8.29	200H	Fail	Pass	Fail for Bad sound		Pass	Fail	
		2019.9.2	300H	Fail	Pass	Fail for Bad sound		Pass	Fail	
		2019.9.7	400H	Fail	Pass	Fail for Bad sound		Pass	Fail	
		2019.9.12	500H	Fail	Pass	Fail for Bad sound		Pass	Fail	
Test condition	Temperature	60°C		Humidity	85%		Time	500H		

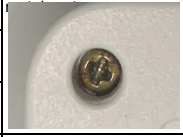

Model number	Product Picture	Test date/time		Appearance	Function				Result	Remark
		Date	Time		Button	Volume/Sound	Pairing	Code		
595P-E		2019.8.24	100H	Pass	Pass	Fail for Bad sound	/	Pass	Fail	Function checked ok, but with bad sound, Speaker membrane is thin, it deformed after long time high temperature and high humidity environment. And also found some small rust spots on metal part, glue has slightly fell off
		2019.8.29	200H	Pass	Pass	Fail for Bad sound		Pass	Fail	
		2019.9.2	300H	Pass	Pass	Fail for Bad sound		Pass	Fail	
		2019.9.7	400H	Pass	Pass	Fail for Bad sound		Pass	Fail	
		2019.9.12	500H	Pass	Pass	Fail for Bad sound		Pass	Fail	
L-209		2019.8.24	100H	Pass	Pass	Fail for Bad sound	/	Pass	Fail	Function checked ok, but with bad sound, Speaker membrane is thin, it deformed after long time high temperature and high humidity environment. And also found some small rust spots on metal part.
		2019.8.29	200H	Pass	Pass	Fail for Bad sound		Pass	Fail	
		2019.9.2	300H	Pass	Pass	Fail for Bad sound		Pass	Fail	
		2019.9.7	400H	Pass	Pass	Fail for Bad sound		Pass	Fail	
		2019.9.12	500H	Pass	Pass	Fail for Bad sound		Pass	Fail	
Test condition	Temperature	60°C		Humidity	85%		Time	500H		

Model number	Product Picture	Test date/time		Appearance	Function				Result	Remark
		Date	Time		Button	Volume/Sound	Pairing	Code		
L-201		2019.8.24	100H	Pass					Pass	Function checked OK, and no deformation found after test.
		2019.8.29	200H	Pass					Pass	
		2019.9.2	300H	Pass					Pass	
		2019.9.7	400H	Pass					Pass	
		2019.9.12	500H	Pass					Pass	
532P		2019.8.24	100H	Fail	Pass	Pass		Pass	Fail	Product start deform from 100h test, After 500h test, product seriously deform, and sound quality fail, this Receiver housing injected by ABS757, this material nature can not resist long time high temperature environment. Sound quality fail: Speaker membrane is thin, it deformed badly after long time high temperature and high humidity environment.
		2019.8.29	200H	Fail	Pass	Pass		Pass	Fail	
		2019.9.2	300H	Fail	Pass	Pass		Pass	Fail	
		2019.9.7	400H	Fail	Pass	Pass		Pass	Fail	
		2019.9.12	500H	Fail	Pass	Pass		Pass	Fail	
FBN		2019.8.24	100H	Fail	Pass			Pass	Fail	Product start deform from 100h test, After 500h test, product seriously deform, this housing injected by ABS757, this material nature can not resist long time high temperature.
		2019.8.29	200H	Fail	Pass			Pass	Fail	
		2019.9.2	300H	Fail	Pass			Pass	Fail	
		2019.9.7	400H	Fail	Pass			Pass	Fail	
		2019.9.12	500H	Fail	Pass			Pass	Fail	
Test condition	Temperature	60°C		Humidity	85%		Time	500H		
I2		2019.8.24	100H	Pass					Pass	small rust spots were found metal part
		2019.8.29	200H	Pass					Pass	
		2019.9.2	300H	Pass					Pass	
		2019.9.7	400H	Pass					Pass	
		2019.9.12	500H	Pass					Pass	
C2		2019.8.24	100H	Fail	Pass				Fail	Product start deform from 100h test, After 500h test, product seriously deform, this housing injected by ABS757, this material nature can not resist long time high temperature environment.
		2019.8.29	200H	Fail	Pass				Fail	
		2019.9.2	300H	Fail	Pass				Fail	
		2019.9.7	400H	Fail	Pass				Fail	
		2019.9.12	500H	Fail	Pass				Fail	
Test condition	Temperature	60°C		Humidity	85%		Time	500H		

Model number	Product Picture	Test date/time		Appearance	Function				Result	Remark
		Date	Time		Button	Volume/Sound	Pairing	Code		
M2		2019.8.24	100H	Pass					Pass	small rust spots were found on metal part
		2019.8.29	200H	Pass					Pass	
		2019.9.2	300H	Pass					Pass	
		2019.9.7	400H	Pass					Pass	
		2019.9.12	500H	Pass					Pass	
X开关		2019.8.24	100H	Fail	Pass				Fail	Product start deform from 100h test, After 500h test, product seriously deform, this housing injected by ABS757, this material nature can not resist long time high temperature environment. Metal part got rust, but f
		2019.8.29	200H	Fail	Pass				Fail	
		2019.9.2	300H	Fail	Pass				Fail	
		2019.9.7	400H	Fail	Pass				Fail	
		2019.9.12	500H	Fail	Pass				Fail	
LA2		2019.8.24	100H	Pass	Fail				Fail	Metal part got rust, cause button not function
		2019.8.29	200H	Pass	Fail				Fail	
		2019.9.2	300H	Pass	Fail				Fail	
		2019.9.7	400H	Pass	Fail				Fail	
		2019.9.12	500H	Pass	Fail				Fail	
Test condition	Temperature	60°C		Humidity	85%		Time	500H		

